

VEHICLE REPORT

BMW X1

2022

VIN | **LBVHY3101NM403493**

 **GENERATED**
Feb 5, 2026

 **FUEL TYPE**
Petrol

 **VIN**
LBVHY3101NM403493

 **REPORT ID**
#6b8b38dcffad

Overall Evaluation

Vehicle risk assessment and purchase recommendation

VEHICLE CONDITION

Fair Condition

● Approved with Caution

Vehicle is in fair condition exhibiting multiple minor collisions and required structural repairs, with otherwise stable mileage and routine maintenance.

KEY FINDINGS

5

● **Four minor collisions recorded** 
Based on: Accident history shows four low-severity impacts on different panels

● **Five components need minor structural repair** 
Based on: Structural assessment identified five areas requiring minor repair

● **Insurance coverage gap over 180 days** 
Based on: Insurance records show a lapse exceeding 180 days and no liability policy

- Consistent maintenance history



Based on: Twelve service records over two years with regular oil, filter changes, and repairs

- No major damage incidents



Based on: No records of major collisions, fire, water damage, or theft



RECOMMENDATION

⌚ **Approved with Caution**

Given the minor collision history and structural work alongside a consistent maintenance record, a thorough inspection of repaired areas is advised before purchase.

Vehicle Identity

Complete specifications and identification details



2022 sDrive20Li Luxury

BRAND

BMW

SERIES

BMW X1

YEAR

2022

MANUFACTURER

Brilliance BMW

VIN **LBVHY3101NM403493**



Engine

Displacement
1.5

Displacement (ml)
1499

Engine Model
B38A15C

Fuel Type
Petrol

Fuel Grade
95 RON

Emission Standard
China VI

Fuel Consumption
6.2 L/100km



Transmission

Gearbox
7-speed wet dual-clutch

Type
Wet dual-clutch transmission (DCT)

Drive Type
Front-engine, front-wheel drive



Dimensions

Length
4565 mm

Width
1821 mm

Height
1620 mm

Wheelbase
2780 mm

Front Track
1563 mm

Rear Track
1564 mm



Weight & Capacity

Curb Weight
1565 kg

Seats
5

Doors
5



Tires & Chassis

Front Tire
225/50 R18

Rear Tire
225/50 R18



Classification

Body Style

SUV

Vehicle Class

Compact SUV

Commercial Vehicle

No



Market Information

MSRP

¥302,800

Market Date

2021.12

Vehicle Title

Title status assessment and implications

Clean



Clean Title

The vehicle has only minor collision history with low-severity impacts and no major structural damage or total-loss events. All repairs are minor and there are no signs of flood, fire, or title branding.

KEY FACTORS

1

Minor accident history



Based on: Inspection records show four small collisions with only low-severity damage

2

No major structural damage



Based on: Structural assessment reports only five components needing minor repair and no frame-level compromise

3

No flood or fire incidents



Based on: Accident history explicitly notes no water or fire damage

4

Uninterrupted repair completion



Based on: All required minor repairs have been addressed according to the assessment



Financing

Clean title supports standard financing terms.



Insurance

No title issues affecting insurance coverage availability.



Resale Value

Clean history supports stronger resale value.

Body Appearance Checklist

Detailed inspection results for all body panels

GRADE

C

● NORMAL

6 / 11

● MINOR

5 / 11

● MAJOR

0 / 11



Fair Condition

Multiple minor damages observed, resulting in moderate overall condition



Detailed Panel Status

Front Frame	 Minor Repair	Minor impact damage recorded
Rear Frame	 Minor Repair	Minor impact damage recorded
Roof Structure	 Normal	No damage detected
Undercarriage	 Normal	No damage detected
Front Left Panel	 Minor Repair	Minor impact damage recorded
Rear Left Panel	 Normal	No damage detected
Middle Left Panel	 Normal	No damage detected
Front Right Panel	 Normal	No damage detected
Rear Right Panel	 Minor Repair	Minor impact damage recorded
Middle Right Panel	 Minor Repair	Minor impact damage recorded
Interior	 Normal	No damage detected

Accident & Damage Records

Reported collision and damage history

 **4 Records**

1 Collision

 **Minor**

 Affected Area	 Data Source	 Type
Front Frame	Insurance Records	Collision

Minor collision impact on front frame

2 Collision

 **Minor**

 Affected Area	 Data Source	 Type
Front Left Panel	Insurance Records	Collision

Minor collision impact on front left panel

3 Collision

● Minor

Affected Area **Rear Frame** Data Source **Insurance Records** Type **Collision**

Minor collision impact on rear frame

4 Collision

● Minor

Affected Area **Middle Right Panel** Data Source **Insurance Records** Type **Collision**

Minor collision impact on middle right panel

🕒 4 minor collisions recorded, no major incidents

Mileage Verification Timeline

Complete odometer reading history from registration and service records




CURRENT MILEAGE

34,113 km

ODOMETER TREND

— Mileage (km)

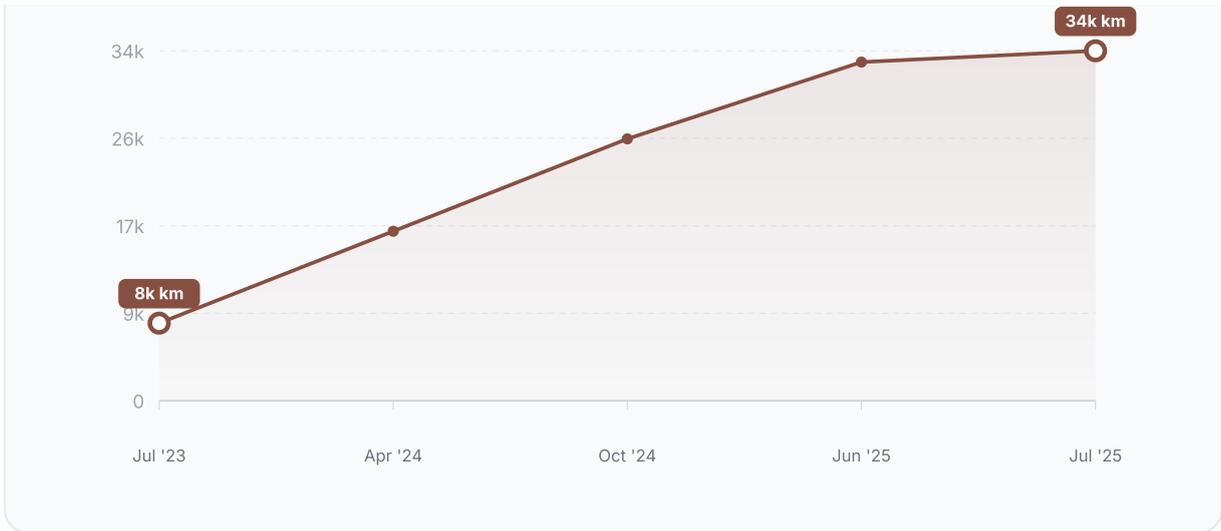


26,547
 km / year
AVG ANNUAL


5
 entries
TOTAL RECORDS


Jul 2023
 7,566 km
FIRST RECORD


Jul 2025
 34,113 km
LATEST RECORD

 ALL RECORDS

DATE	MILEAGE	SOURCE	STATUS
Jul 2023	7,566 km	Registration	 Verified
Apr 2024	16,521 km +8,955	Service Record	 Verified
Oct 2024	25,527 km +9,006	Service Record	 Verified
Jun 2025	33,013 km +7,486	Service Record	 Verified
Jul 2025	34,113 km +1,100	Current Reading	 Verified



Odometer Verified

Mileage Verified - No Anomalies Detected



Maintenance Record Summary

10 Records

Complete service history with detailed maintenance records and parts replacement



LAST SERVICE

Jul 5, 2025

Most recent service visit



OIL CHANGES

4 services

Oil & lubrication services



PARTS REPLACED

10 services

Service visits with parts work



Maintenance History Timeline

Chronological record of all services



Jul 5, 2025



LATEST

Maintenance

↻ 34,113 km

Removal and installation or renewal of external fuel filter

Engine oil service

Standard maintenance scope

Air filter element service



PARTS & WORK



Fuel filter



Oil filter element assembly



Air filter element



BMW genuine engine oil LL-04 5W-30



 **Jul 5, 2025**

Repair

 34,113 km

VHC vehicle health check

 **PARTS & WORK**

 None



 **Jul 3, 2025**

Repair

 34,113 km

Replace rear bumper trim support beam

Bodywork repair on right rear storage area and rear panel (see parts list)

Bodywork quoting for rear bumper removal – right rear impact

Painting of right rear storage area and right rear panel

Replace one right rear exhaust trim

Remove and install rear bumper trim panel

Replace middle lower rear bumper guard (black and white)

Paint rear bumper guard

VHC vehicle health check

 **PARTS & WORK**

 Chrome-plated tailpipe cover

 Rear right reflector

 Center rear bumper trim panel

 Rear bumper trim

 Ultrasonic sensor (black)

 Expansion rivets

 Rear bumper bracket

 Rear tow hook cover



 **Jun 5, 2025**

Repair

↻ 33,013 km

VHC vehicle health check
Brake fluid service

 PARTS & WORK

 Brake fluid



 **Oct 12, 2024**

Repair

↻ 25,527 km

VHC vehicle health check

 PARTS & WORK

 None



 **Oct 12, 2024**

Maintenance

↻ 25,527 km

Engine oil service
Standard maintenance scope

 PARTS & WORK

 Oil filter element assembly

 BMW genuine engine oil LL-04 5W-30



 **Apr 5, 2024**

Maintenance

↻ 16,521 km

Standard maintenance scope

Removal and installation or renewal of external fuel filter

Engine oil service

Air filter element service

 PARTS & WORK

-  BMW genuine engine oil LL-04 5W-30
-  Oil filter element assembly
-  Air filter element
-  Fuel filter



 **Apr 5, 2024**

Repair

 16,521 km

VHC vehicle health check

 PARTS & WORK

-  None



 **Jul 1, 2023**

Inspection

 7,566 km

Vehicle testing

VHC vehicle health check

 PARTS & WORK

-  None



 **Jul 1, 2023**

Maintenance

 7,566 km

Standard maintenance scope

Engine oil service

 PARTS & WORK

 Oil filter element assembly

 BMW genuine engine oil LL-04 5W-30

Insurance Claims

Vehicle insurance claim history



Clean Record

No insurance claims found for this vehicle.



Report Disclaimer & Trust Signals

This vehicle history report is compiled from multiple trusted data sources to provide you with comprehensive information about this vehicle's past.

DATA SOURCES



State DMV Records



Insurance Companies



Service Centers



Auto Auctions



Collision Repair Facilities



Fire & Police
Departments



IMPORTANT NOTICE

This report is provided for informational purposes only. While we strive for accuracy, China Vehicle History does not guarantee the completeness or accuracy of the information contained herein. This report should be used as one of several tools in evaluating a vehicle purchase. We recommend a professional mechanical inspection before any vehicle purchase.

